# VAISALA



# **DPT146 Dewpoint and Pressure Transmitter** for Compressed Air



The DPT146 measures both dew point and process pressure. Monitoring compressed air is simpler and quicker, helping you to make more informed decisions.

The Vaisala Dewpoint and Pressure Transmitter DPT146 for Compressed Air makes monitoring compressed air simple and convenient. The DPT146 measures both dew point and process pressure simultaneously, and is the ideal choice for anyone using or monitoring compressed air.

# Make More Informed Decisions

For the first time, dew point data – whether calculated to atmospheric pressure or providing ppm – is constantly pressure compensated online and in real-time so there is no ambiguity in the information. Decision making and corrective actions can now be based on more reliable and accurate data. Regulative requirements, for example for medical gas, can also be fulfilled more easily and quickly.


# Simple and Efficient Installation

One transmitter providing two of the most important compressed

air measurements means reduced installation costs and a much easier setup – with only one instrument needing connection and wiring.

# A Unique Combination of Two World-Class Sensors

The DPT146 combines the knowledge of more than 20 years of sensor-technology development. Proven measurements from the DRYCAP® sensor for dew point and the BAROCAP® sensor for pressure are now combined into one easy-to-use transmitter.

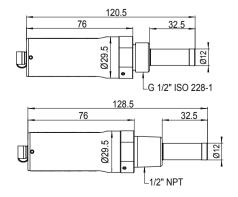


### Features/Benefits

- The first transmitter that monitors both dew point and process pressure
- A simple and convenient transmitter for monitoring of compressed air
- Highly accurate humidity information thanks to online pressure-compensated dew point data
- Proven sensor technology
- Compatible with the Vaisala Hand-Held DM70 for easy spot checking, local display and data logging
- Pressure: 1 ... 10 bar
- Dew point: -60 ... +30 °C (-76 ... +86 °F) Tdf with accuracy of ±2°C (±3.6 °F)

# Convenience with Proven Performance

Well-developed technology brings both proven results and convenience. Spot-checking and verification of dew point is easy thanks to full compatibility with the Vaisala DRYCAP® Hand-Held Dewpoint Meter DM70. The DM70 can also be used as a local display and data logger for monitoring all measured parameters. Additionally, also temperature measurement is available when the RS485 serial line is in use.

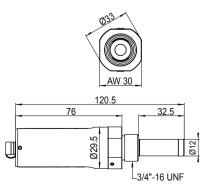

# **Technical Data**

#### **Measured Parameters**


Dew point	-60+30 °C (-76+86 °F)
Pressure, absolute	1 10 bar (14.5 145 psi)
Temperature (available if output	
RS-485 only selected)	-40+80 °C (-40+176 °F)

## **Calculated Parameters**

ppm moisture, by volume	1 40 000 ppm
Dew point, converted to	
atmospheric pressure	-75 +30 °C (-103 +86 °F)

### **Performance**

Dew point accuracy	±2 °C (±3.6 °F)
Pressure accuracy at 23 °C (73.4 °F)	±0.4 %FS
Pressure temperature dependence	±0.1 %FS/10 °C (18 °F)
Temperature accuracy	
040 °C (+32+104 °F)	±0.5 °C (± 0.9 °F)
-4080 °C (-40+176 °F)	±1 °C (± 1.8 °F)
PPM accuracy (7 bar)	$\pm (14 \text{ ppm} + 12\% \text{ of reading})$
Sensor response time:	
Pressure response time	< 1 s
Dew point response time 63% [90%]	at 20°C and 1 bar
-50 -> -10 °C Tdf	5 s [ 10 s]
-10 -> -50 °C Tdf	10 s [ 2.5 min]

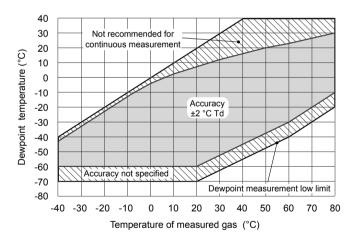

DPT146 Dewpoint Measurement Accuracy

### **Operating Environment**

Operating temperature of electronics	-40 +60 °C
	(-40+140 °F)
Operating Pressure	0 50 bar (0725 psi)

Relative humidity	0100 %
Measured gases	Air/ non-corrosive gases
Sample flow rate	no effect on measurement accuracy

### **Outputs**

Analog Outputs (2 channels)	
current output	0 20 mA,4 20 mA
voltage output	0 5V,010V
Accuracy of analog outputs	$\pm 0.01  \text{V} / \pm 0.01  \text{mA}$
Digital output	RS-485, non-isolated, Vaisala protocol
Connector	4-pin M8

#### General

Sensor	Vaisala MPS1 multiparameter sensor
Operating voltage	21 28 VDC, current output
	20 28 VDC, voltage output and/or use
	in cold temperatures (-4020 °C (-404 °F))
	15 28 VDC, RS485 only

Supply current

9	
during self-diagnostics	300 mA + load current
External load for	
current output	max.500 Ohm
voltage output	min. 10 kOhm
Housing material	AISI316L

20 mA + load current

Housing classification IP65 (NEMA4) Sensor protection Mesh filter AISI303, grade 18 μm

Storage temperature range

during normal measurement

-40 ... +80 °C (-40 ...+176 °F) transmitter only shipment package -20 ... +80 °C (-4 ...+176 °F) ISO G1/2", NPT 1/2", UNF 3/4"-16 Mechanical connection Recommended calibration interval 2 years Weight (ISO1/2") 190 g (6.70 oz) Complies with EMC standard EN61326-1, Electrical equipment

for measurement, control and laboratory use - EMC requirements; Industrial environment

### **Accessories**

7.0000001100	
Connection cable for MI70 indicator /DM70 meter 2	
USB connection cable	219690
Sampling cells DMT242SC, DMT242SC2, DSC74, DSC74	4B, DSC74C
Flange	DM240FA
Loop-powered external display	226476
ISO 1/2" plug	218773
NPT 1/2" plug	222507





Ref. B211159EN-B @Vaisala 2011 This material is subject to copyright protection, with all copyrights retained by Vaisala and its individual partners. All rights reserved. Any logos and/or product names are trademarks of Vaisala or its individual partners. The reproduction, transfer, distribution or storage of information contained in this brochure in any form without the prior written consent of Vaisala is strictly prohibited. All specifications - technical included - are subject